


Semiconductor Fuses

LV HRC SITOR Fuse Links


Configuration Aids

Dimensional drawings


3NC2 4...-1, 3NC8 4...

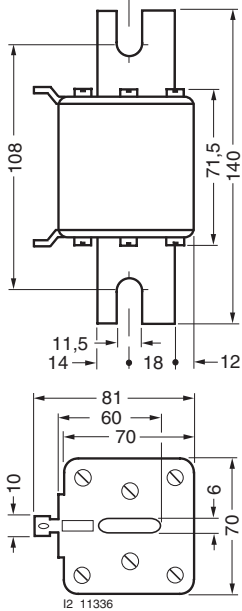


3NC2 4...-3, 3NC8 4...-3

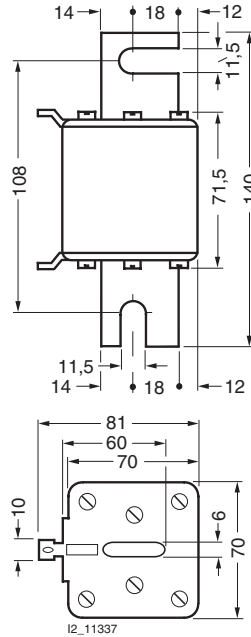


3NE8 7...-1

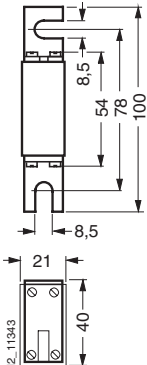


3NE1 8...-0

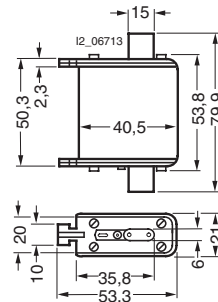


3NE1 02...-0, 3NE1 02...-2, 3NE8 0...-1

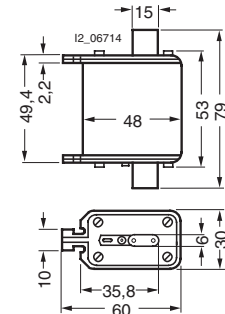


3NE1 2...-0, 3NE1 2...-2

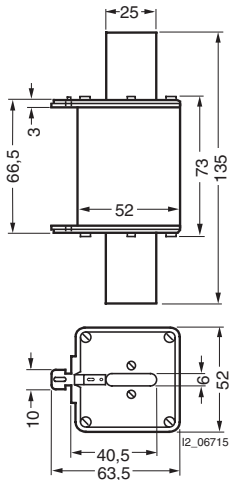


3NE1 33...-0, 3NE1 33...-2

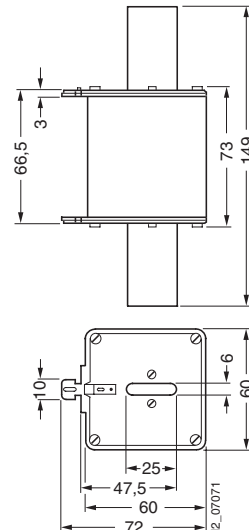

3NE1 43...-0, 3NE1 43...-1

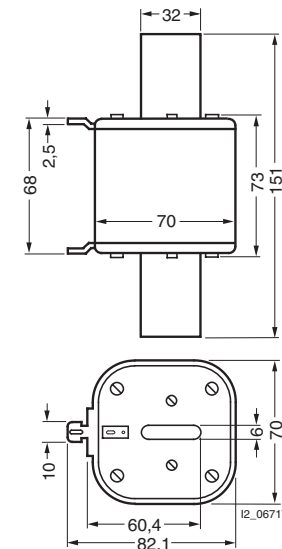



3NE1 4...-2

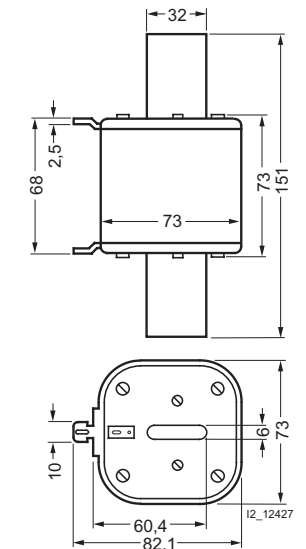



Semiconductor Fuses

LV HRC SITOR Fuse Links


Configuration Aids

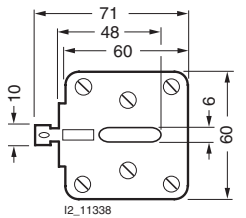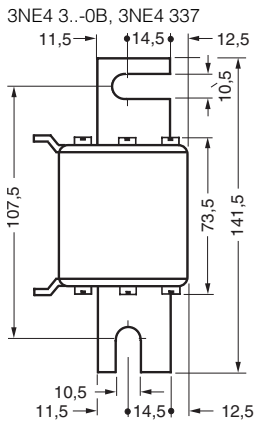


3NE3 4..., 3NE3 6..., 3NE3 637-1,
3NE5 4..., 3NE5 433-1, 3NE5 6...,
3NE7 4..., 3NE7 6..., 3NE9 63.-1

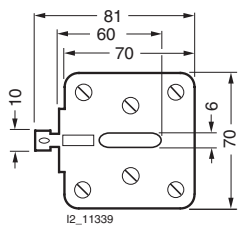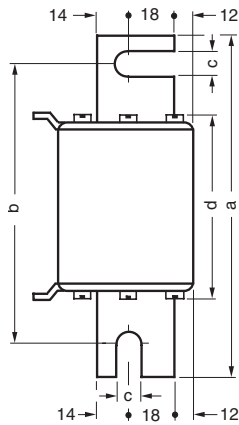

Type	Dimensions			
	a	b	c	d
3NE3 4..., 3NE3 6..	160	128	11.5	91.5
3NE3 635-6	see adjacent drawing			
3NE3 637-1	170	138	13	91.5
3NE5 4..., 3NE7 4..., 3NE7 6..	240	208	11.5	171.5
3NE5 433-1, 3NE7 6..-1	240	208	13	171.5
3NE5 6..	200	168	11.5	131.5
3NE9 63.-1	287	255	13	220

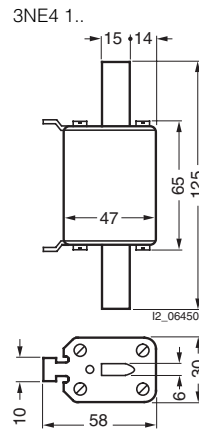

3NE3 22., 3NE3 23., 3NE3 3..

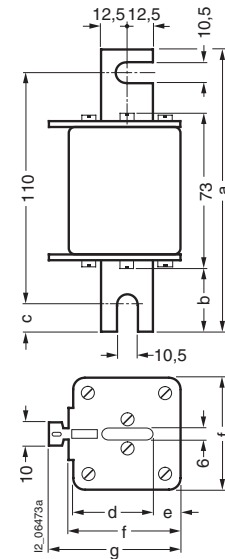

Type	Dimensions						
	a	b	c	d	e	f	g
3NE3 22., 3NE3 23.	135	31	12.5	40.5	13.5	52	63.5
3NE3 3..	149	38	19.5	47.5	15	60	72

3NE3 635-6

